


PIPE FLASHING OVER FIELD OR FACTORY SEAM



NOTE:

1. REFER TO GENFLEX™ WEBSITE FOR THE MOST CURRENT INFORMATION.
2. REMOVE ALL EXISTING FLASHING, LEAD, ETC. PIPE SURFACE MUST BE FREE OF ALL RUST, GREASE, INSULATION, ETC.
3. PIPE MUST BE ANCHORED TO ENSURE STABILITY.
4. PRE-MOLDED PEEL & STICK PIPE BOOT MAY BE CUT TO HEIGHT, BUT NO LOWER THAN REINFORCING RING (NO WRINKLES OR FOLDS UNDER CLAMPING RING).
5. APPLY EDGE CAULK BETWEEN PENETRATION AND PRE-MOLDED PIPE FLASHING PRIOR TO INSTALLATION OF CLAMPING RING. REFER TO EZE-PS-LS-09 FOR SEAM EDGE TREATMENT.
6. PRE-MOLDED PIPE FLASHING FITS 1"(25 mm) -6" (152 mm) PENETRATIONS SIZES.
7. DO NOT USE WHEN SERVICE LINE TEMP. EXCEEDS 180 °F (82 °C). REFER TO EZE-PS-P-04.

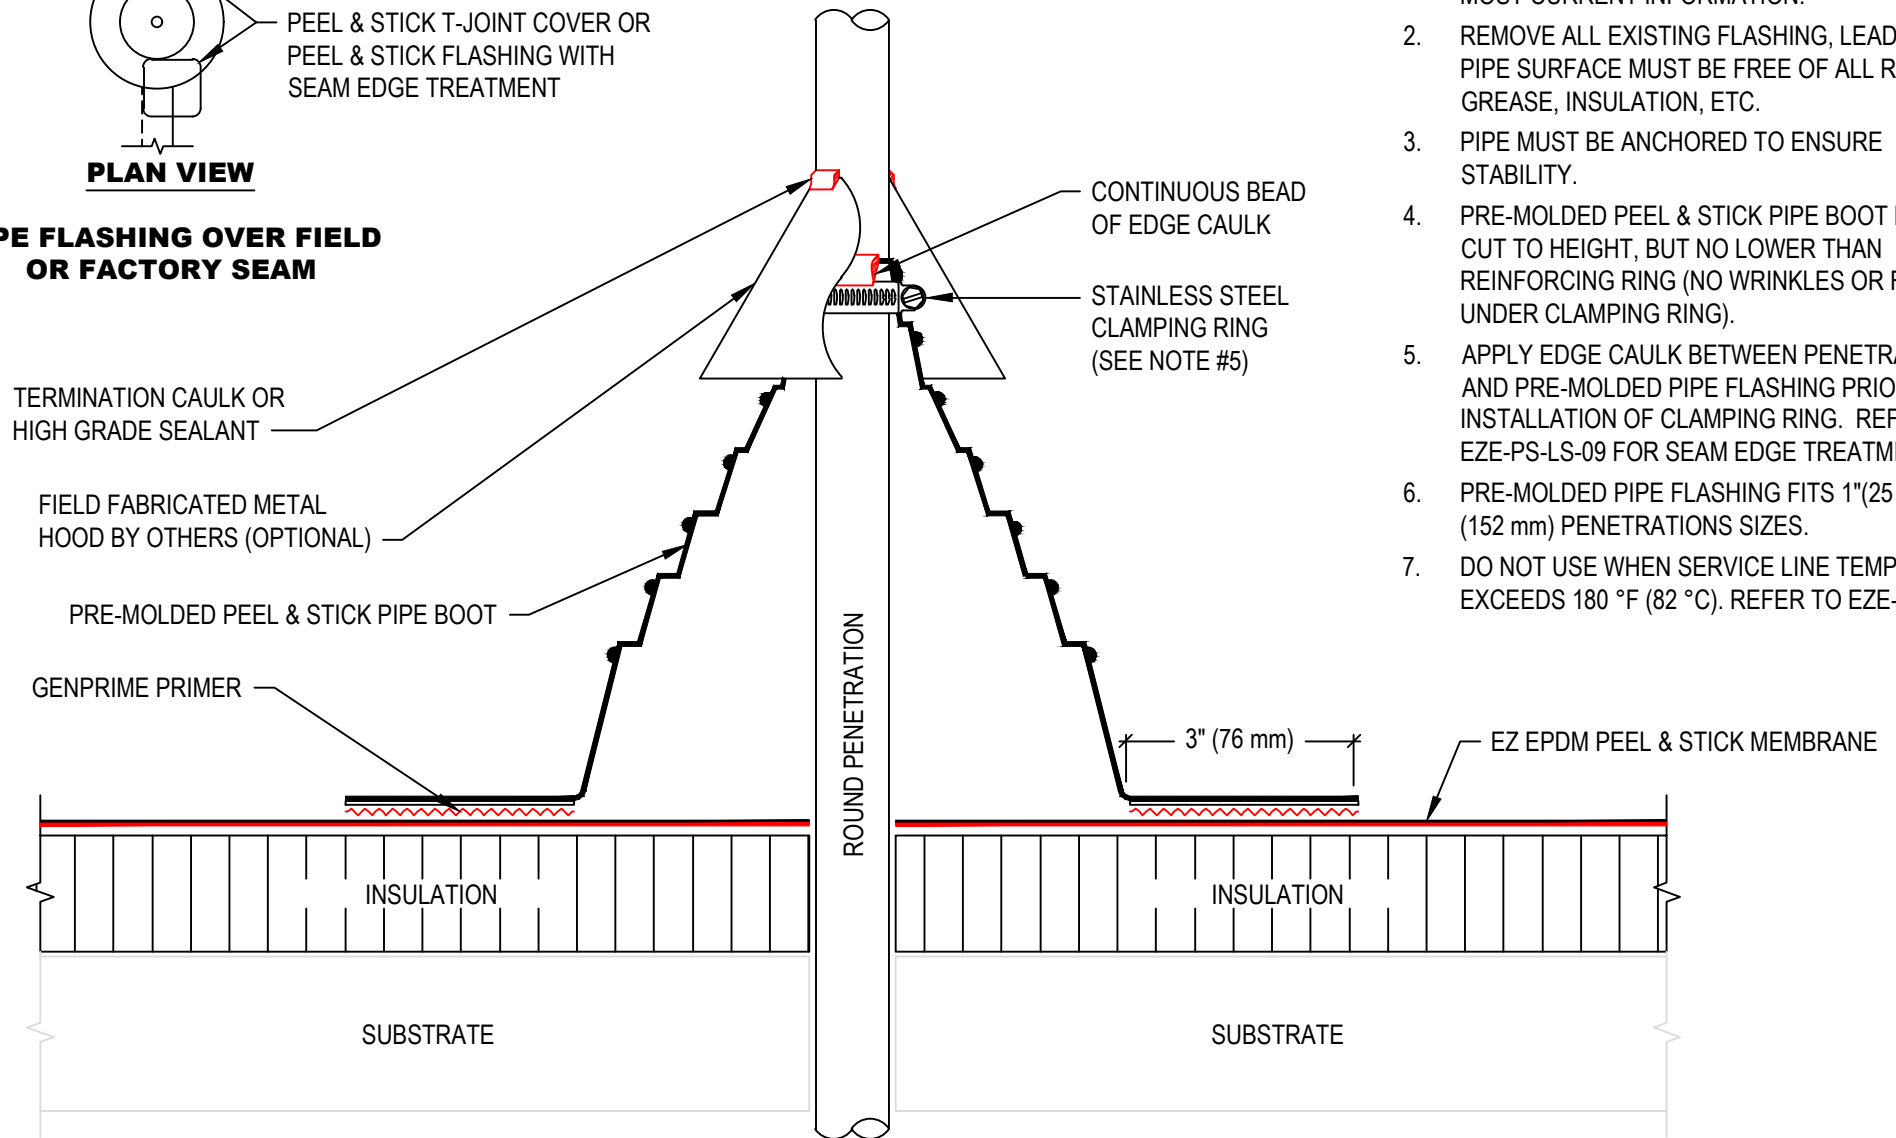

PENETRATION WITH PEEL & STICK PIPE FLASHING

ACCEPTABLE SYSTEMS: EZ EPDM PEEL & STICK™ SELF ADHERED

(800) 443-4272 www.genflex.com

MAXIMUM WARRANTY: 20 Years

ISSUE / REVISION DATE:

07/28/2023

NOT TO SCALE

DETAIL NO.

EZE-PS-P-01