


GenFlex Fasteners and Seam Plates Centered Over Spacing Dots. See Detail T-6.05. Refer to the GenFlex web site for the most current GenFlex TPO Fastening Matrix for fastener spacing requirements.

1 1/2" Min.  
(38.10 mm)  
Hot Air Weld\*

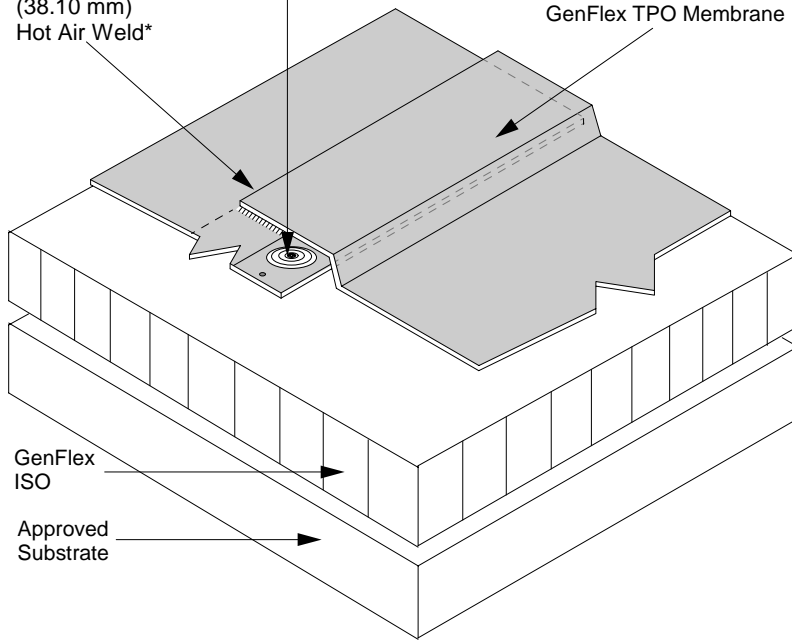


GenFlex  
ISO

Approved  
Substrate


**Layout Lines**

**6' Panels**

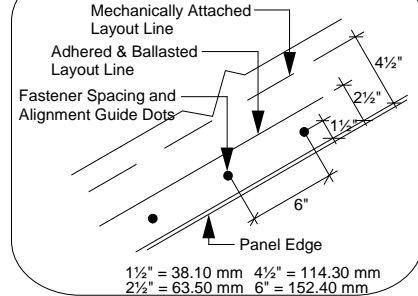

1 1/2" = 38.10 mm    4 1/2" = 114.30 mm  
2 1/2" = 63.50 mm    6" = 152.40 mm

**8', 10', & 12' Panels**

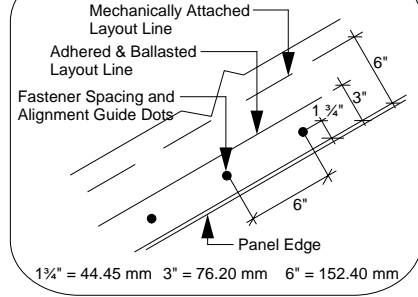

1 3/4" = 44.45 mm    3" = 76.20 mm    6" = 152.40 mm

\*Position adjacent membrane panels on the factory-applied dashed reference line, and install membrane securement as required, centered over fastener and spacing dotted reference line.



10/06

**Single Weld Seam**

**Detail #: T-6.02**

**TPO Mechanically Attached Systems**